



Chevrolet
 P.O. Box 909989
 Milwaukee, WI 53209-9989

IMPORTANT SAFETY RECALL

14309 VIN removed 13 0009060

14309 **VIN removed** 13 0009060
 STATE OF ALASKA
 2200 E 42ND AVE
 ANCHORAGE, AK 99508-5202



Note: Vehicle-specific info such as make, year, model, and VIN has been removed by DOT SEF to create a "generic" letter and that info has been placed in the body of the recall email message sent to the state agency by SEF. - SD

August 2014

Dear State Of Alaska:

This notice is sent to you in accordance with the National Traffic and Motor Vehicle Safety Act.

General Motors has decided that a defect which relates to motor vehicle safety exists in certain **xxxxx** model year **GM vehicle** repaired under safety recall 12180. As a result, GM is conducting a safety recall. We apologize for this inconvenience. However, we are concerned about your safety and continued satisfaction with our products.

IMPORTANT

- This notice applies to your **xxxxx** model year **GM vehicle** VIN **VIN info removed**.
- Your vehicle is involved in GM recall 14309.

Why is your vehicle being recalled?

Previously, your vehicle was serviced under safety recall 12180, which provided that if the driver's door module was functioning properly, a protective coating was to be applied. If the module was not working properly, it was to be replaced. Your vehicle was repaired by having a protective coating applied to the driver's door module and may continue to have a safety related defect.

If fluid, such as melted snow containing road salt, enters the driver's door module, it may cause corrosion that could result in a short in the circuit board. A short may cause the power door lock and power window switches to function intermittently or may stop working. A short may cause overheating, which could melt components of the door module, producing odor, smoke, or a fire. Additionally, the windows may raise or lower themselves, without user input. These conditions may occur even with the vehicle parked and the key removed.

What will we do?

PARTS ARE NOT CURRENTLY AVAILABLE. but when parts are available. your Chevrolet dealer will install a new door module. This service will be performed for you at no charge.




We are working as quickly as possible to correct this condition. When parts are available, we will send you another letter asking you to take your vehicle to your Chevrolet dealer to have your vehicle serviced. If you have already paid for repairs for this condition and did not submit for reimbursement under safety recall 12180, a reimbursement request form will be included with the letter.

It is advised that you park your vehicle outdoors until it has been remedied.

Do you have questions?

If you have questions or concerns that your dealer is unable to resolve, please contact the Chevrolet Customer Assistance Center at 1.800.222.1020 (TTY 1.800.833.2438).

Federal regulation requires that any vehicle lessor receiving this recall notice must forward a copy of this notice to the lessee within ten days.

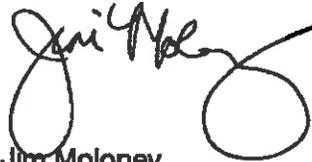

Jim Moloney
General Director - Customer & Relationship Services

GM Recall #14309